Features

- 1-channel signal conditioner
- 24 V DC supply (loop powered)
- 2- or 3-wire Pt100 RTD input
- Output 4 mA ... 20 mA, temperature linearization selectable
- DIP switch selectable ranges
- Sensor breakage detection


Function

This isolated signal conditioner is a loop-powered isolator that converts the resistance from a 3-wire RTD to a 4 mA ... 20 mA signal and provides isolation for non-intrinsically safe applications.


A selectable analog linearization ensures a temperature linear 4 mA ... 20 mA output between 25 °C ... 375 °C.

It also features conveniently located DIP switches and potentiometers to make field calibration easy.

Assembly

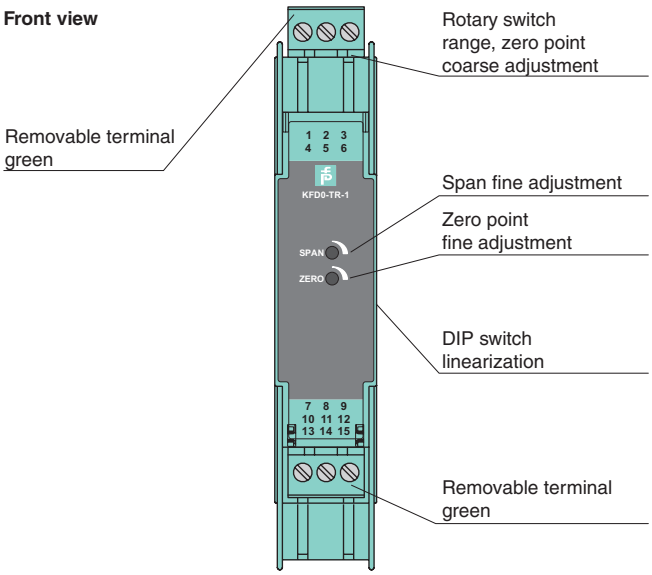

Connection

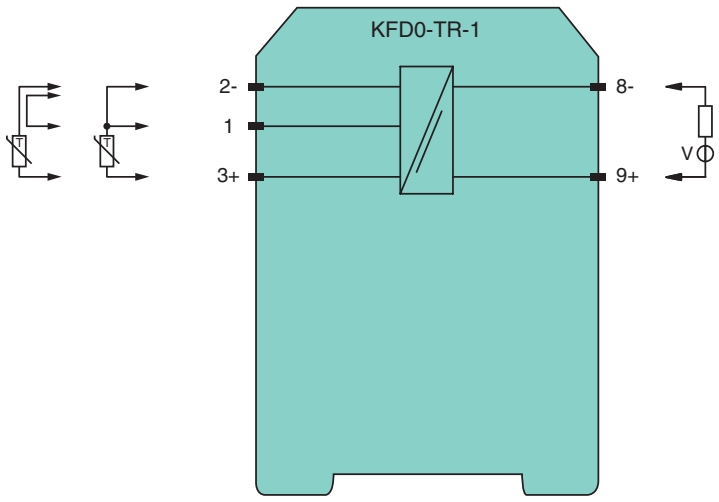

Release date 2010-11-04 Date of issue 2010-11-04 038307_ENG.xml

Subject to reasonable modifications due to technical advances.
Copyright Pepperl+Fuchs, Printed in Germany


General specifications	
Signal type	Analog input
Supply	
Rated voltage	12 ... 35 V DC loop powered
Power loss	0.4 W
Input	
Connection	terminals 1, 2-, 3+ suitable for Pt100, 2- and 3-wire connection
Lead resistance	≤ 100 Ω per lead
Measuring current	approx. 1 mA
Output	
Connection	terminals 9+, 8-
Load	(U -12 V) / 0.02 A
Current output	4 ... 20 mA , limited to ≤ 35 mA
Fault signal	Sensor burnout: upscaling ≥ 22 mA , limited to ≤ 35 mA
Transfer characteristics	
Measurement range f_n	span without linearization 25 ... 800 °C (77 ... 1472 °F)/ with linearisation 25 ... 375 °C (77 ... 707 °F) zero point without linearization -200 ... 400 °C (-328 ... 752 °F)/ with linearisation -30 ... 375 °C (-22 ... 707 °F) span and zero point adjustable
Deviation	
After calibration	0.1 % of full-scale value
Influence of ambient temperature	span and zero point 0.015 % / K or ± 10 mΩ / K
Influence of supply voltage	6.5 ppm/V
Rise time	250 ms
Electrical isolation	
Input/Output	safe isolation acc. to DIN VDE 0106, rated insulation voltage 253 V_{eff}
Directive conformity	
Electromagnetic compatibility	
Directive 2004/108/EC	EN 61326-1:2006
Conformity	
Insulation coordination	EN 50178
Electrical isolation	EN 50178
Electromagnetic compatibility	NE 21
Protection degree	IEC 60529
Ambient conditions	
Ambient temperature	-20 ... 60 °C (-4 ... 140 °F)
Mechanical specifications	
Protection degree	IP20
Mass	approx. 150 g
Dimensions	20 x 119 x 115 mm (0.8 x 4.7 x 4.5 in) , housing type B2
General information	
Supplementary information	Statement of Conformity, Declaration of Conformity, Attestation of Conformity and instructions have to be observed where applicable. For information see www.pepperl-fuchs.com.

Release date 2010-11-04 14:08 Date of issue 2010-11-04 038307_ENG.xml

Subject to reasonable modifications due to technical advances. Copyright Pepperl+Fuchs, Printed in Germany

Configuration


DIP switches function

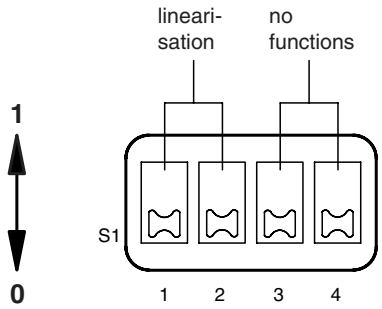

Switch	Position	Function
S1.1 S1.2	1 0	Pt100 with linearisation (-30 °C ... 375 °C)
S1.1 S1.2	0 1	Pt100 without linearisation (-200 °C ... 800 °C)

Other combinations of S1.1 and S1.2 are not allowed.

Rotary switches function

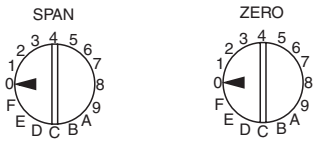

Please consider that both tables contain typical values, which can be used as an adjustment help.

Adjustment range with linearisation					
Switch SPAN (°C) coarse adjustment	D 20 ... 60	6 35 ... 100	2 75 ... 220	1 120 ... 340	0 260 ... 375
Switch ZERO (°C) coarse adjustment					
0	-	-	-	-	-
1	-	-	-	-	-
2	-	-	-	-	-
3	-	-	-	-	-
4	-	-	-	-	-
5	-19 ... 50	-22 ... 45	-30 ... 29	-30 ... 13	-
6	35 ... 103	30 ... 97	16 ... 78	2 ... 61	-30 ... 0
7	87 ... 155	82 ... 148	65 ... 127	48 ... 107	-10 ... 38
8	142 ... 207	134 ... 200	115 ... 177	96 ... 154	28 ... 76
9	192 ... 257	185 ... 249	162 ... 223	141 ... 198	65 ... 111
A	245 ... 306	234 ... 297	209 ... 269	185 ... 242	-
B	290 ... 355	282 ... 344	254 ... 315	-	-
C	338 ... 375	329 ... 375	-	-	-
D	-	-	-	-	-
E	-	-	-	-	-
F	-	-	-	-	-

Adjustment range without linearisation					
Switch SPAN (°C) coarse adjustment	D 25 ... 60	6 40 ... 100	2 90 ... 230	1 140 ... 360	0 320 ... 800
Switch ZERO (°C) coarse adjustment					
0	-	-	-	-	-
1	-200 ... -171	-200 ... -172	-200 ... -176	-200 ... -179	-
2	-183 ... -112	-184 ... -115	-188 ... -122	-191 ... -129	-200 ... -153
3	-126 ... -54	-127 ... -54	-134 ... -67	-140 ... -77	-163 ... -111
4	-68 ... -6	-71 ... 1	-80 ... -12	-90 ... -24	-122 ... -70
5	-9 ... 65	-14 ... 59	-26 ... 42	-38 ... 27	-80 ... -29
6	48 ... 123	43 ... 116	28 ... 97	14 ... 78	-40 ... 12
7	107 ... 182	101 ... 175	82 ... 151	65 ... 130	1 ... 53
8	168 ... 243	160 ... 234	138 ... 208	117 ... 183	43 ... 95
9	226 ... 302	217 ... 292	192 ... 262	168 ... 234	82 ... 135
A	284 ... 361	274 ... 350	246 ... 317	219 ... 285	122 ... 174
B	343 ... 400	331 ... 400	300 ... 372	270 ... 337	162 ... 215
C	-	-	353 ... 400	320 ... 388	201 ... 254
D	-	-	-	37 ... 400	241 ... 293
E	-	-	-	-	279 ... 333
F	-	-	-	-	318 ... 372

Release date 2010-11-04 14:08 Date of issue 2010-11-04 038307_ENG.xml

Subject to reasonable modifications due to technical advances. Copyright Pepperl+Fuchs, Printed in Germany

Recommendation for adjustment:

1. Span determination.
2. "Span coarse adjustment" in accordance with the table (for mode of operation "without linearisation" considering the approx. measurement range start).
3. Minimum value adjustment (in °C) at the input.
4. "Zero point coarse adjustment" to approach to 4 mA.
5. "Zero point fine adjustment" to exactly 4 mA.
6. Maximum value adjustment (in °C) at the input.
7. "Span fine adjustment" to exactly 20 mA.
8. If necessary repeat fine adjustment for 4 mA and 20 mA

Release date 2010-11-04 14:08 Date of issue 2010-11-04 038307_ENG.xml

Subject to reasonable modifications due to technical advances. Copyright Pepperl+Fuchs, Printed in Germany